


Annual Air Monitoring Network Plan Santa Barbara County Public Draft

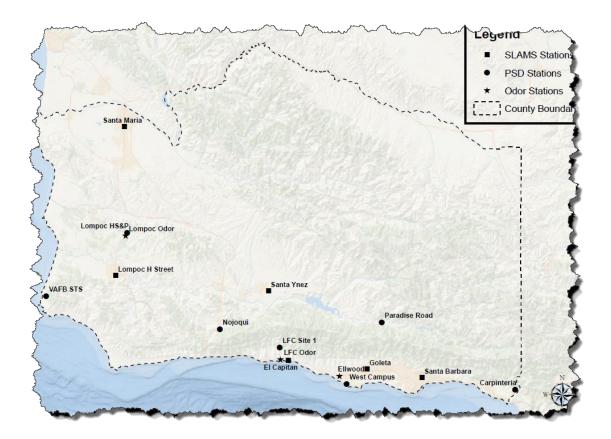

May 29, 2016

Prepared by the Santa Barbara County Air Pollution Control District

Annual Air Monitoring Network Plan For Santa Barbara County

Table of Contents

<u>Section</u>	<u>on</u>	Page
1.0	Introducti	on4
1.1 1.2 1.3	Stations.	5
2.0	Monitorin	g Requirements 11
2.1 2.2 2.3 2.4 2.5 2.6 2.7 2.8 2.9	Carbon M Nitrogen Sulfur Dic Particulat Particulat Lead (Pb Recent or	Image: Monoxide (CO) 12 Dioxide (NO2) 12 oxide (SO2) 13 e Matter (PM10) 14 e Matter (PM2.5) 14) 15 r Proposed Modifications to the Network 16
3.0	Additiona	I information on PM2.5 monitors18
3.1 3.2		
4.0	Quality A	ssurance and Data Submittal19
4.1 4.2 4.3	Data subi	mittal
5.0	Detailed S	Site Information 20
Gloss	Introduction 4 Network Design 4 Stations 5 Monitoring Requirements 8 Monitoring Requirements 11 Ozone (O3) 11 Carbon Monoxide (CO) 12 Nitrogen Dioxide (NO2) 12 Sulfur Dioxide (SO2) 13 Particulate Matter (PM10) 14 Particulate Matter (PM2.5) 14 Lead (Pb) 15 Recent or Proposed Modifications to the Network 16 Additional Monitors 17 Additional information on PM2.5 monitors 18 Comparison to annual PM2.5 NAAQS 18 Review of changes to PM2.5 network 18 Quality Assurance and Data Submittal 19 Annual performance evaluation 19 Data submittal 19 Annual certification 19 Data submittal 19	
Apper Apper	ndix B ndix C	EPA Approval of PM2.5 Network Modification B 1 Suspension of PM monitoring at Santa Barbara Armory Site
Apper	ndix D	

List of Tables

<u>Table</u>	Page
1.1	Monitoring Network in Santa Barbara County
1.2	Relationship between Site Types and
	Scales of Representativeness
1.3	Measured Parameters with Spatial Scale and
	Monitoring Objective
2.1	Minimum Monitoring Requirements for Ozone
2.2	Minimum Monitoring Requirements for Carbon Monoxide
2.3	Minimum Monitoring Requirements for Nitrogen Dioxide
2.4	Minimum Monitoring Requirements for Sulfur Dioxide
2.5	Minimum Monitoring Requirements for PM10
2.6a	Minimum Monitoring Requirements for PM2.5-total monitors15
2.6b	Minimum Monitoring Requirements for PM2.5-continous15
2.7a	Minimum Monitoring Requirements for Pb-NCORE16
2.7b	Minimum Monitoring Requirements for Pb-Source16
5.1	Carpinteria Monitoring Station Details
5.2	El Capitan Monitoring Station Details
5.3	Ellwood Odor Monitoring Station Details
5.4	Goleta Monitoring Station Details
5.5	Las Flores Canyon #1 Monitoring Station Details
5.6	Las Flores Canyon Odor Monitoring Station Details
5.7	Lompoc HS&P Monitoring Station Details
5.8	Lompoc H Street Monitoring Station Details
5.9	Lompoc Odor Monitoring Station Details
5.10	Nojoqui Monitoring Station Details
5.11	Paradise Road Monitoring Station Details
5.12	Santa Barbara Monitoring Station Details
5.13	Santa Maria Monitoring Station Details
5.14	Santa Ynez Monitoring Station Details
5.15	UCSB West Campus Monitoring Station Details
5.16	VAFB STS Monitoring Station Details

List of Figures

<u>Figure</u>		<u>Page</u>
1.1	Map of Monitoring Network in Santa Barbara County	7

1.0 Introduction

This report describes the network of ambient air quality monitors in Santa Barbara County. This report was prepared to meet the requirements for an annual network plan as listed in Title 40, Part 58, Section 10 of the Code of Federal Regulations (40 CFR 58.10). The language of 40 CFR 58.10 is included in Appendix A of this report. The regulations require that this annual monitoring network plan be submitted to the U.S. Environmental Protection Agency (EPA) by July 1 of each year. The plan must be made available for public inspections for at least 30 days prior to submission to EPA. This draft plan is available for public review and comment from May 29 through June 28, 2016.

This review is used to determine if the State and Local Air Monitoring Station (SLAMS) network in Santa Barbara County meets the U.S. Environmental Protection Agency (EPA) criteria for station siting based on the EPA monitoring objectives. This network review ensures that the data collected by the SLAMS air monitoring network in Santa Barbara County is representative and will satisfy the data needs of EPA, California Air Resources Board (CARB), and the Santa Barbara County Air Pollution Control District (SBCAPCD).

This network plan includes SLAMS monitors which are federal reference methods (FRM), federal equivalent methods (FEM), or approved regional methods (ARM). Special purpose monitors (SPM) are also included in this plan. The SPMs in Santa Barbara County consist of a number of Prevention of Significant Deterioration (PSD) sites operated by the SBCAPCD or private contractors. There are a number of major oil and gas developments in Santa Barbara County with permits for the production, processing and transportation of oil and gas. These oil and gas permits trigger the PSD monitoring requirements.

1.1 Network Design

The air monitoring network in Santa Barbara County consists of SLAMS and SPM operated by the SBCAPCD, California Air Resources Board (CARB) and private contractors. The monitoring network is designed to cover the diverse range of topography, meteorology, emissions and air quality in Santa Barbara County, while adequately representing the population in the county.

Santa Barbara County has agreed to coordinate the air monitoring network design with CARB through the joint PQAO Roles and Responsibilities agreement between the two agencies. Item 5 of this agreement stipulates that both agencies will coordinate any site changes in the network, assuring that requirements of the network design are met. Complete details of the Roles and Responsibilities can be obtained from the following link: http://arb.ca.gov/aagm/ga/pgao/repository/santa_barbara_rolesandresponsibilitie

http://arb.ca.gov/aaqm/qa/pqao/repository/santa_barbara_rolesandresponsibilitie s.pdf

This network review is used to determine if the monitoring system meets the monitoring objectives defined in 40 CFR 58 Appendix D. The three basic monitoring objectives as described in Appendix D are:

- 1) Provide air pollution data to the general public in a timely manner.
- 2) Support compliance with ambient air quality standards and emissions strategy development.
- 3) Support for air pollution research studies.

1.2 Stations

In order to support the air quality management work indicated in the three basic air monitoring objectives, the network is designed with a variety of monitoring site types. There are six general site types:


- 1) Highest concentrations expected to occur in the area.
- 2) Typical concentrations in areas of high population density.
- 3) Impact of significant sources on air quality.
- 4) General background concentration levels.
- 5) Regional pollutant transport among populated areas.
- 6) Air pollution impact on visibility, vegetation damage or other welfare-based impacts.

There are 16 ambient air monitoring stations located in Santa Barbara County. The map in Figure 1.1 shows the location of each site. These sites are operated for different objectives. There are six SLAMS stations which are sited to measure the typical concentrations in areas of high population density or to monitor the impacts of regional pollution. Two of these sites (Santa Barbara and Santa Maria) are operated by CARB. The other four SLAMS sites (Goleta, El Capitan, Lompoc H Street, and Santa Ynez) are operated by SBCAPCD.

There are ten sites which were installed as part of the PSD network to measure the impacts of stationary sources and to measure regional air quality. These sites are classified as SPM. Carpinteria, Exxon LFC 1, Lompoc HS & P, Nojoqui, Paradise Road, and VAFB STS were installed with ozone monitors to measure regional air quality in Santa Barbara County. Of these sites, Paradise Road, Carpenteria and Exxon LFC 1 have measured the highest Ozone concentrations in the county. The Nojoqui monitoring station was located in a pass between the northern and southern portions of Santa Barbara County to measure transport between the two portions of the county. Exxon LFC 1, West Campus, Lompoc HS & P, and VAFB STS contain monitors to measure the impacts of nearby sources. Lompoc Odor, LFC Odor and Ellwood Odor are located near oil and gas processing facilities to monitor odorous compounds: hydrogen sulfide and

total reduced sulfur. The Ellwood Odor site was temporarily shut down on October 22, 2015 due to the loss of lease and the inability to find an acceptable alternative location. The permit holder was granted a variance, allowing the temporary shut down until a site location suitable to the District was found. A copy of the variance is attached in Appendix D. Table 1.1 lists the sites in Santa Barbara County and identifies the site's EPA AQS identification code, type of site, and operator. The sites in the table are numbered to match the site numbers of the map shown in Figure 1.1.

Figure 1.1 Map of Monitoring Network in Santa Barbara County

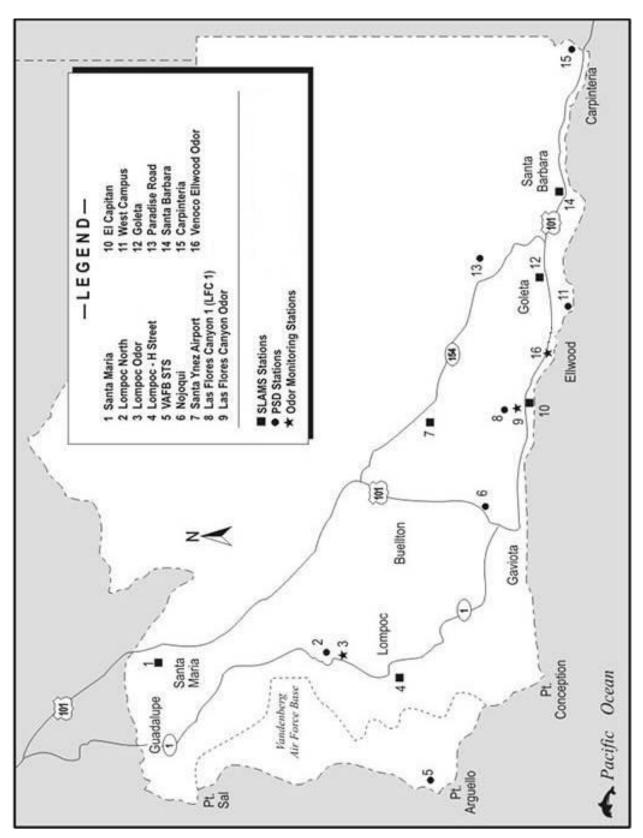

No.	Site Name	Site Code	Туре	Operator
1	Santa Maria	060831008	SLAMS	CARB
2	Lompoc HS & P	060831013	PSD	Contractor
3	Lompoc Odor	060831022	PSD	Contractor
4	Lompoc H Street	060832004	SLAMS	SBCAPCD
5	VAFB STS	060834003	PSD	SBCAPCD
6	Nojoqui	060831018	PSD	SBCAPCD
7	Santa Ynez	060833001	SLAMS	SBCAPCD
8	Exxon LFC 1	060831025	PSD	SBCAPCD
9	LFC Odor	060831037	PSD	SBCAPCD
10	El Capitan	060830008	SLAMS	SBCAPCD
11	West Campus	060831020	PSD	Contractor
12	Goleta	060832011	SLAMS	SBCAPCD
13	Paradise Road	060831014	PSD	Contractor
14	Santa Barbara – Canon	060830011	SLAMS	CARB
	Perdido			
15	Carpinteria	060831021	PSD	Contractor
16	Ellwood Odor	060831032	PSD	Contractor

Table 1.1 Monitoring Network in Santa Barbara County

Note: Ellwood Odor temporarily shut down on October 22, 2015, see above in Section 1.2 and Appendix D for further information.

1.3 Monitors

Many of the sites in the monitoring network serve multi-purposes. They may be ideal for background concentration for one pollutant while also measuring the impact of transport for another pollutant. To clarify the nature of the link between the general monitoring objectives, site types, and physical location of a particular monitor, the concept of spatial scale of representativeness is defined. The goal of locating monitors is to correctly match the spatial scale represented by the sample of monitored air with the spatial scale most appropriate for the monitoring site type, air pollutant to be measured, and the monitoring site types are described as follows:

- 1) Micro scale Defines the concentrations in air volumes associated with area dimensions ranging from several meters up to about 100 meters.
- Middle scale Defines the concentration typical of areas up to several city blocks in size with dimensions ranging from about 100 meters to 0.5 kilometer.

- Neighborhood scale Defines concentrations within some extended area of the city that has relatively uniform land use with dimensions in the 0.5 to 4.0 kilometers range.
- 4) Urban scale Defines concentrations within an area of city like dimensions, on the order of 4 to 50 kilometers.
- Regional scale Defines usually a rural area of reasonably homogeneous geography without large sources, and extends from tens to hundreds of kilometers.

Classification of the monitor by its type and spatial scale of representativeness aids in the interpretation of the monitoring data for a particular monitoring objective. Table 1.2 illustrates the relationship between the various site types that can be used to support the three basic monitoring objectives and the scales of representativeness that are generally most appropriate for that type of site.

Table 1.2
Relationship between Site Types and Scales of Representativeness

Site Type	Appropriate Siting Scales
Highest concentration	Micro, middle, neighborhood
	(sometimes urban or regional for
	secondarily formed pollutants)
Population oriented	Neighborhood, urban
Source Impact	Micro, middle, neighborhood
General/background and regional	Urban, regional
transport	
Welfare-related impacts	Urban, regional

The sites and the monitors located at each site in Santa Barbara County are listed in Table 1.3. The table includes the spatial scale and monitoring objective for each monitored pollutant.

Table 1.3
Measured Parameters with Spatial Scale and Monitoring Objective

Parameter	03	NO2	SO2	СО	PM-2.5	PM-10	THC	H2S	TRS
AIRS Pollutant Code	44201	42602	42401	42101	88101	81102	43101	42402	43911
Carpinteria	RS/HC	RS/BL							
El Capitan	RS/BL	RS/BL	RS/BL			NS/BL	RS/BL		
Ellwood Odor								NS/IM	NS/IM
Goleta	US/PO	US/PO		NS/PO	NS/PO	NS/PO			
Las Flores Cyn 1	RS/HC	NS/IM	NS/IM	NS/IM		NS/IM	NS/IM		
LFC Odor								NS/IM	
Lompoc H St.	NS/PO	NS/PO	NS/PO	NS/PO	NS/PO	NS/PO			
Lompoc HSP	RS/BL	NS/IM	NS/IM				NS/IM		
Lompoc Odor								NS/IM	NS/IM
Nojoqui	RS/BL	RS/BL							
Paradise Road	RS/HC	RS/BL							
Santa Barbara	US/PO	NS/HC		MS/HC	NS/HC	NS/HC			
Santa Maria	US/PO	US/PO		MS/HC	NS/PO	NS/PO			
Santa Ynez	US/PO								
VAFB STS	RS/BL	NS/IM	NS/IM	NS/IM		NS/IM	NS/IM		
West Campus			NS/IM				NS/IM	NS/IM	NS/IM

Spatial Scale:

- MI Microscale
- MS Middle Scale
- NS Neighborhood Scale
- US Urban Scale
- RS Regional Scale
- NG National and Global scale

Monitoring Objective:

- HC Highest concentration
- PO Population Oriented
- IM Source Impact
- BL Background Levels
- WR Welfare-related impacts

Note: Las Flores Canyon#1 PM10 monitor is classified as Neighborhood Scale due to the dominant source being the large nearby oil and gas facility. VAFB STS PM10 spatial scale is classified as Neighborhood Scale due to the dominate source being the nearby power plant. PM2.5 was changed from NON-FEM to FEM SLAMS at the Lompoc H Street site on January 1, 2015. This change to the network was approved by EPA on May 22, 2015 (see Appendix B). Ellwood Odor was temporarily shut down on October 22, 2015, see section 1.2 and Appendix D for details.

2.0 Monitoring Requirements

EPA regulations specify the minimum number of sites at which state and local air agencies must deploy monitors. Santa Barbara County meets or exceeds EPA's minimum requirements. In practice, the state and local agencies find they need to deploy more monitors than required by the law. The additional monitors are needed to fulfill state and local purposes for monitoring that are in addition to the federal purposes. A number of monitors are required by permits issued to operate stationary emission sources. California State air quality standards are more stringent than national standards and require more monitors to show compliance with the state standards. Monitors are also used to keep the public informed of the actual air quality conditions where they live and work. Also, due to the complex topography in Santa Barbara County, more monitors than the minimum required by EPA are needed to properly characterize the air quality in the county.

The requirements for numbers of monitors appear in Appendix D of Part 58 of the CFR. For ozone, PM2.5, and PM10, the required minimum number is based on the population of an area and the severity of the air quality for the pollutant in the area. For other pollutants, no monitoring is required unless an area exceeds or is close to exceeding a national ambient air quality standard. For purposes of the minimum requirements, the areas are defined by the metropolitan statistical areas (MSAs) developed by the U.S. Census Bureau. Santa Barbara County is part of the Santa Barbara – Santa Maria MSA. It covers the major cities in our county and has a population count of 444,769 based on the 2015 U.S. Census estimate.

2.1 Ozone (O3)

The minimum monitoring requirements for ozone are listed in Table 2.1. Santa Barbara County has 12 ozone monitors, although only six of these sites are SLAMS sites, which meet the requirements of EPA. Santa Barbara County has a design value of .067 ppm based on 2013 – 2015 data which meets the new federal 8-hour ozone standard of 0.070 ppm. Santa Barbara County is nonattainment for the state 8-hour ozone standard based on the June 2013 designations. The Exxon LFC1 site recorded concentrations of ozone in excess of the new federal and state 8-hour ozone standard in 2015. Data from ozone monitors in Santa Barbara County are utilized to inform the public on air quality through AQI reporting and air quality mapping. Additionally, the data from these sites are compared to the NAAQS and state standards to assess attainment/nonattainment.

Table 2.1 Minimum Monitoring Requirements for Ozone

MSA	County	Pop. (year)	8-hour Design Value (years) ²	Design Value Site (name, AQS ID)	Min. # Sites Required	# Sites Active ¹	Sites Needed
Santa Barbara – Santa Maria, CA	Santa Barbara County	444,769 (2015)	.067 ppm 2013 - 2015	Carpinteria, 060831021	2	6	0

¹Only SLAMS monitors are eligible to be counted towards meeting minimum monitoring requirements. In addition, ozone monitors that do not meet traffic count/distance requirements to be neighborhood or urban scale (40 CFR 58 Appendix E, Table E-1) cannot be counted towards minimum monitoring requirements.

² DV Years = the three years over which the design value (DV) was calculated (e.g., 2008-2010)

Monitors required for SIP or Maintenance Plan: Santa Barbara County has a maintenance plan for ozone that requires any modification to the existing ozone network to be approved by EPA.

2.2 Carbon Monoxide (CO)

There are no EPA minimum requirements for the number of CO monitoring sites for CBSA's with a population less than one million. For CBSA's with a population of one million or greater, near roadway CO monitors are required. Continued operation of existing SLAMS CO sites is required until discontinuation is approved by the EPA. There are four SLAMS CO monitors located at Goleta, Lompoc H Street, Santa Barbara and Santa Maria which are used to measure the impacts of high population exposure and are not near roadway monitors. There are also CO monitors located at Exxon LFC1 and VAFB STS which are required by operating permit conditions issued to nearby sources.

Table 2.2 Near Roadway Monitoring Requirements

CBSA/MSA	Pop. (year)	# Required Near Roadway Monitors	# Active Near Roadway Monitors	# Additional Monitors Needed
Santa Barbara Santa	444,769 (2015)	0	0	0
Maria, CA				

Monitors required for SIP or Maintenance Plan: None

EPA Regional Administrator-required monitors per 40 CFR 58, App.D 4.2.2:

2.3 Nitrogen Dioxide (NO2)

On January 22, 2010, EPA strengthened the health-based NAAQS for NO2. The rule also established new ambient air monitoring and reporting requirements. One "near road" monitor will be required in urban areas with a population greater than or equal to 500,000 people. A second monitor is required near another major road in areas with either a population greater than or equal to 2.5 million people or a road segment with an annual average daily traffic count greater than or equal to 250,000 vehicles. One community wide monitor is required in urban areas with a population of greater than or equal to 1 million people. Santa Barbara does not meet any of these criteria so no additional monitors will be

required. Continued operation of existing SLAMS NO2 sites is required until discontinuation is approved by the EPA. There are five SLAMS NO2 monitors. Goleta, Lompoc H Street, Santa Barbara, and Santa Maria are used to measure the impacts of high population exposure and El Capitan monitors the pollutant on a regional scale There are six other sites which measure NO2: Carpinteria, Exxon LFC 1, Nojoqui, Paradise Road, Lompoc HS & P, and VAFB STS. These monitors are required by operating permit conditions of nearby sources and are used to measure the impact of sources on regional ozone formation. Table 2.3 lists the minimum monitoring requirements for Nitrogen Dioxide.

Table 2.3
Minimum Monitoring Requirements for Nitrogen Dioxide

CBSA/ MSA	Pop. (year)	Max AADT	# Required Near Roadway	# Active Near Roadway	# Additional Near Roadway needed	# Required Area-wide	# Active Area- wide ¹	# Additional Area-wide needed
Santa Barbara Santa Maria, CA	444,769 (2015)	N/A (below pop. Threshold)	0	0	0	0	5	0

¹Only SLAMS sites can be counted for minimum monitoring requirements Monitors required for SIP or Maintenance Plan: None

Monitors required for PAMS: None

EPA Regional Administrator-required monitors per 40 CFR 58, App. D 4.3.4:

2.4 Sulfur Dioxide (SO2)

EPA strengthened the primary NAAQS for SO2 on June 2, 2010. The rule established a new 1 hour standard and revised the monitoring requirements. Monitors will be required based on Core Based Statistical Areas (CBSAs) based on a population weighted emissions index for the area. Three monitors will be required in CBSAs with index values of 1,000,000 or more. Two monitors will be required in CBSAs with index values less than 1,000,000 but greater than 100,000; and 1 monitor will be required in CBSAs with index values greater than 5,000. Continued operation of existing SLAMS SO2 sites is required until discontinuation is approved by the EPA. There are two SLAMS SO2 monitors at El Capitan and Lompoc H Street which are used to measure the impacts of high population exposure. There are four other sites which measure SO2: Exxon LFC 1, UCSB West Campus, Lompoc HS&P, and VAFB STS. These monitors are required by operating permit conditions of nearby sources and are used to measure the impact of sources on the surrounding air quality. New SO2 monitors must be operational by January 1, 2013. Table 2.4 lists the minimum monitoring requirements for SO2. No additional monitors will be required in Santa Barbara County.

Table 2.4 Minimum Monitoring Requirements for Sulfur Dioxide

CBSA/MSA	County	Pop. (year)	Total SO2 ¹ (Ton/yr)	Population Weighted Emissions Index ²	# Required Monitors	# Active Monitors ³	# Additional Monitors Required
Santa Barbara Santa Maria, CA	Santa Barbara	444,769 (2015)	441.5	196.4	0	2	0

¹Using NEI data (2011)

²Calculated by multiplying CBSA population and total SO₂ and dividing product by one million ³Only SLAMS sites can be counted for minimum monitoring requirement

Monitors required for SIP or Maintenance Plan: None

EPA Regional Administrator-required monitors per 40 CFR 58, App. D 4.4.3:

2.5 Particulate Matter (PM10)

The minimum monitoring requirements for PM10 are listed in Table 2.5. There are five SLAMS PM10 monitors located at Santa Barbara, El Capitan, Goleta, Lompoc H Street, and Santa Maria. There are two PSD sites which measure PM10: Exxon LFC 1 and VAFB STS. These monitors are required by operating permit conditions of nearby sources and are used to measure the impact of nearby sources on the surrounding air quality.

MSA	County	Pop. (year)	Max 24 Hour Concentration (ug/m3)	Max Concentration Site (name, AQS ID)	# Required Sites	# Active Sites ¹	# Additional SitesNeeded
Santa Barbara – Santa Maria, CA	Santa Barbara County	444,769 (2015)	135 (08/29/15)	El Capitan 060830008	0-1	5	0

Table 2.5Minimum Monitoring Requirements for PM10

¹Only SLAMS sites can be counted for minimum monitoring requirement Monitors required for SIP or Maintenance Plan:None

2.6 Particulate Matter (PM2.5)

The minimum monitoring requirements for PM2.5 are listed in Tables 2.6a and b. Note that the Santa Barbara site (operated by CARB) did not meet completeness requirements in 2015.

There are four PM2.5 monitors located at Santa Barbara, Santa Maria, Goleta, and Lompoc H Street. Santa Barbara and Santa Maria had FRM samplers but were removed in June 2010 and were replaced with FEM real time samplers. Lompoc H Street and Goleta had Non-FEM real time samplers that were switched to FEM real time samplers (Goleta was switched on January 1, 2014 and Lompoc H Street was switched on January 1, 2015). Santa Barbara County received approval of this change in status from EPA on May 22, 2015 (See

Appendix B). Because there is insufficient FEM PM2.5 data for the period 2013-2015 the monitors at Lompoc H Street and Goleta are not included in the design value calculations listed in Tables 2.6a and Tables 2.6b. Because the Santa Barbara site (operated by CARB) did not meet data completeness requirements, it also was not included in the design value calculations listed in Tables 2.6a and Tables 2.6b.

PM2.5 colocation requirements are based on the primary quality assurance organization (PQAO) network. Santa Barbara County is part of the CARB PQAO. See the CARB annual network plan for details on meeting the PM2.5 colocation requirements.

Table 2.6a
Minimum Monitoring Requirements for PM2.5 Monitors

MSA	County	Pop. (year)	Annual Design Value (years ¹)	Annual Design Value Site (name, AQS ID)	Daily Design Value (years)	Daily Design Value Site (name, AQS ID)	# Required SLAMS Sites	# Active SLAMS Sites ^{3,4}	# Additional SLAMS Sites Needed
Santa Barbara – Santa Maria, Ca	Santa Barbara County	444,769 (2015)	7.7 ug/m3 2013 – 2015	Santa Maria 06-083- 1008	16 ug/m3 2013 - 2015	Santa Maria 06-083- 1008	0	4	0

¹DV Years = the three years over which the design value (DV) was calculated (e.g., 2008-2010) ³As of January 1, 2015

⁴Only SLAMS sites can be counted for minimum monitoring requirement

Table 2.6b Minimum Monitoring Requirements for Continuous PM2.5 Monitors

MSA	County	Pop. (year)	Annual Design Value (years ¹)	Annual Design Value Site (name, AQS ID)	Daily Design Value (years)	Daily Design Value Site (name, AQS ID)	# Required Cont. Monitors	# Active Cont. Monitors ^{3,4}	# Addition al Cont. Monitor s ² Needed
Santa Barbara – Santa Maria, Ca	Santa Barbara County	444,769 (2015)	7.7 ug/m3 2013 – 2015	Santa Maria 06-083- 1008	16 ug/m3 2013 - 2015	Santa Maria 06-083- 1008	0	4	0

¹DV Years = the three years over which the design value (DV) was calculated (e.g., 2008-2010) ² Only count one continuous monitor per site.

³As of January 1, 2015

⁴Only SLAMS sites can be counted for minimum monitoring requirement

Monitors required for SIP or Maintenance Plan: None

2.7 Lead (Pb)

EPA substantially strengthened the NAAQS for lead on October 15, 2008. The level of the primary standard was revised from 1.5 ug/m3 down to 0.15 ug/m3

measured as total suspended particles (TSP). The secondary standard was revised to be identical to the primary standard. Source oriented Monitors are required in areas with airport sources that emit one ton or more per year of lead or non-airport sources that emit one half ton per year of lead. Additionally, nonsource lead monitoring is required at NCORE sites in a CBSA with a population greater than 500,000. The population of Santa Barbara County is below the 500,000 threshold and there are no NCORE sites required in Santa Barbara County; therefore non-source lead monitors are not required. The highest emission inventory of lead in Santa Barbara County is the Santa Barbara Municipal airport with 0.35 tons per year (2013). Since this is below the threshold, no source oriented lead monitors are required.

Table 2.7aMinimum Monitoring Requirements for Pb at NCORE sites

CBSA/MSA	Pop. (year)	# Required Near Road Monitors	# Active Near Road Monitors	# Additional Monitors Needed
Santa Barbara – Santa Maria, Ca	444,769 (2015)	0	0	0

Table 2.7bMinimum Monitoring Requirements for Source Oriented Pb Monitoring

Source Name	Address	Pb Emissions	Emissions Source (year)	Max Design Value	Desing Value Date	# Required Monitors	# Active Monitors	# Additional Monitors Needed
Santa Barbara Municipal Airport	601 Firestone Rd. Santa Barbara, CA	0.35 ton/yr	National Emissions Inventory	N/A	N/A	0	0	0

Monitors required for SIP or Maintenance Plan: None

EPA Regional Administrator-required monitors per 40 CFR 58, App. D 4.5(c):

2.8 Recent or Proposed Modifications to the Network

The Lompoc H Street site PM2.5 monitoring method was changed on January 1, 2015 from non-FEM (parameter 88501 method 731 to FEM (parameter 88101 method 170). While this modification changed the method that normally does not require EPA approval, this changed also changed the monitor from a SPM to SLAMS, requiring EPA approval. SBCAPCD received approval from EPA of this change on May 22, 2015 (see Appendix B).

Total hydrocarbon measurements at El Capitan were discontinued on January 1, 2015. As this change is for a non-criteria pollutant, approval from EPA is not required.

The NO2 monitor at Lompoc-H was changed from a TAPI 200e to a TEI 42i on March 24, 2015.

As discussed in Section 1.2, the Ellwood Odor site was temporary shut down on October 22, 2015 due to loss of lease. The permit holder responsible this site was unable to find an alternative site location and petitioned the Santa Barbara County Air Pollution Control District Hearing Board for a variance allowing the shutdown until an alternative location could be found. The Hearing Board granted the permit holders request. (see Appendix D) The variance provides up to one year for the permit holder to identify an alternative site location and restart the monitoring site. Should the permit holder be unable to meet this schedule, they can re-apply for another variance. As this change is for non-criteria pollutants, approval from EPA is not required.

ARB temporarily suspended operation of PM10 and PM2.5 samplers at the Santa Barbara-National Guard Armory site for safety concerns on August 28, 2015. No estimated time of resuming operation has been given. (see Appendix C). In addition, ARB notified the SBCAPCD that they were losing their lease in June 2016 due to the sale of the National Guard Armory property. ARB is currently looking for an alternative location.

The permit holders responsible for the operation of the LFC Odor site have negotiated approval from the District to temporary shutdown the site while production at the associated processing plants is shut down. It is anticipated that the site will be temporary shutdown in July 2016 and re-started when production at the associated processing plant resume. As this change is for a non-criteria pollutant, approval from EPA is not required.

There are no further plans to modify the network over the next 18 months. However, the source triggering the requirement for the West Campus Site may be retired, which would eliminate the permit condition requiring the West Campus Site and would therefore eliminate this site. If and when this occurs, EPA will be consulted.

2.9 Additional Monitors

Santa Barbara County operates some monitors which are not required by 40 CFR 58.10. These sites and monitors are included in the network review for reference only and not to show compliance with any requirements even though they are operated under the same quality assurance/control guidelines as the FRM monitors.

There are four stations which are set up near oil and gas processing facilities to monitor for two odorous compounds: Hydrogen sulfide (H2S) and total reduced sulfur (TRS). These monitors are located at the following stations: Lompoc Odor, LFC Odor, Ellwood Odor, and UCSB West Campus.

Total Hydrocarbon monitors (THC) are also located at some of the PSD monitoring stations located near oil and gas processing facilities. These sites are: Exxon LFC 1, Lompoc HS&P, West Campus, and VAFBSTS.

All of the monitoring stations listed in this report also measure wind speed, wind directions and ambient temperature. These data are used for modeling and tracking.

3.0 Additional information on PM2.5 monitors

This section includes information for a couple of elements required to be in the annual network plan that relate specifically to PM2.5. One required element relates to whether data for a PM2.5 monitor can be used to determine compliance with the national annual PM2.5 air quality standard. This is termed as the suitability for comparison to the annual standard. The other element requires information regarding the review process followed by air agencies when changes are made to the location of a PM2.5 monitor that is violating a PM2.5 NAAQS.

3.1 Comparison to annual PM2.5 NAAQS

Only data from a PM2.5 FRM or FEM can be used in regulatory determinations of compliance with the annual PM2.5 NAAQS and that the monitor be located at a neighborhood scale. For a PM2.5 monitor to be representative at a neighborhood scale, the concentration values measured by the monitor should be representative of concentrations expected over an area with dimensions of a few kilometers. Therefore the monitor should not be located too close to a hot spot of PM2.5 concentrations that extends over distances less than a few hundred meters. All of the PM2.5 FRM and FEM monitors in Santa Barbara County are sited to be representative of a neighborhood scale and meet this suitability requirement.

3.2 Review of changes to PM2.5 network

As required by regulation, prior to any changes to the PM2.5 network are made, a formal request is drafted outlining the reason for the change, when the change will occur, and any other relevant information about the proposed changes. The proposal (either as part of an annual network review or between reviews) will be posted on the District website for a 30 day public comment period. Following the comment period, the District will forward the request with comments and District responses to EPA for consideration. Only after EPA has granted approval of the proposed change, will the District make the changes to the PM2.5 monitoring network.

4.0 Quality Assurance and Data Submittal

All data collected from the monitors in the Santa Barbara County network are reviewed for quality assurance by the SBCAPCD with the exception of the Santa Barbara and Santa Maria monitoring stations which are reviewed and processed by CARB. All special purpose monitors (SPM), including monitors in the PSD network meet the requirements of 40 CFR 58, appendix E as well as the requirements in 40 CFR 58, appendix A.

4.1 Annual performance evaluation

Annual performance evaluations challenge the monitors with known concentrations of audit gases to evaluate the accuracy of the monitors. The SLAMS sites as well as the PSD sites operated by SBCAPCD in Santa Barbara County are audited on an annual basis by the CARB. The PSD stations operated by contractors are evaluated by an independent contractor who audits the monitors on a quarterly basis.

4.2 Data submittal

Digital records of the data including precision and accuracy data are submitted to EPA by uploading the records to their air quality system data base (AQS). These records are submitted within 90 days following the end of each quarterly reporting period.

4.3 Annual certification

The data are certified for their accuracy and completeness on an annual basis and a certification letter is submitted to the regional EPA administrator by May 1 of each year.

5.0 Detailed Site Information

The tables in this section give detailed information relating to the sites and monitors. They are presented to show compliance with the monitoring requirements found in 40 CFR 58.10. Please note the following in relation to the detailed site information tables:

- 1. All glass used for inlet/manifold is borosilicate or equivalent.
- 2. There are no collocated monitors located in the SLAMS or PSD networks in Santa Barbara County, therefore information in detailed site information tables do not include fields relating to collocated monitors.
- 3. All collocation requirements are being met by CARB, see the CARB Annual Network Plan for details.
- 4. All sample probes, including low-vol PM samplers are separated horizontally from other station probes by at least one meter.

Table 5.1 Carpinteria Monitoring Station Details

Site Name	Carpinteria							
AQSID	060831021							
GIS coordinates	34.403047-119	45795						
Location		ral setting NE of	the City of Car	pinteria				
Address	Gobernador Road, Carpinteria, CA 93013							
County	Santa Barbara County							
Dist. To road		Gobernador Canyon Road, 115 meters						
Traffic count (AADT,		anyon Road - 50						
year)			000					
Groundcover	Grass							
Representative area		arbara – Santa N	Aaria CA)					
Pollutant, POC	03,1	NO2,1						
Monitor Type	SPM	SPM						
Network Affiliation	PSD	PSD						
Parameter Code	44201	42602						
Monitoring Objective	NAAQS	NAAQS						
Site type(s)	Highest conc.	Gen.						
		background						
Mfg/Model	TAPI 400e	TEI 42C						
Method Code	087	074						
FRM/FEM or other	FEM	FRM						
	Consultant	Consultant						
Collecting Agency	Santa							
Reporting Agency	Barbara	Santa						
		Barbara						
Cratic Casta		County County						
Spatial Scale		Regional Regional						
Start date	1/1/86	1/1/86						
Operation schedule	Continuous	Continuous						
Sampling season	All Year	All Year						
Probe height	4.1 m	4.1 m						
Distance from	1.3 m	1.3 m						
supporting structure				_				
Distance from	None	None						
obstructions on roof								
Distance from	None	None						
obstructions not on								
roof	N.L	N I						
Distance from trees	None	None						
Distance to furnace or	None	None						
incinerator	0000	0000						
Unrestricted airflow	360°	360°						
Probe material	Glass &	Glass &						
Decision d	Teflon	Teflon						
Residence time	18.4 s	19.9 s						
Will there be changes in next 18 months?	No	No						
Frequency of one-	Bi-weekly	Bi-weekly						
point QC check	-	-						
(gaseous)								
Last annual	11/10/2015	11/10/2015						
performance								
evaluation (gaseous)								

Table 5.2 El Capitan Monitoring Station Details

Site Name	El Capitan					
AQS ID	060830008					
GIS coordinates	34.462444-120	0.0255				
Location		nance yard of ca	mparound			
Address	US Hwy 101, El Capitan State Beach, CA 93117					
County	Santa Barbara County					
Dist. to road	HWY 101,100					
Traffic count (AADT,	Hwy 101 - 30,2					
year)		(_0.0)				
Groundcover	Grass and dirt					
Representative area	MSA (Santa Ba	arbara – Santa N	/laria, CA)			
Pollutant, POC	O3,1	NO2,1	SO2,1	PM10,3		
Monitor Type	SLAMS	SLAMS	SLAMS	SLAMS		
Network Affiliation	NA	NA	NA	NA		
Parameter Code	44201	42602	42401	81102		
Monitoring Objective	NAAQS,	NAAQS,	NAAQS,	NAAQS,		
	Public Info	Public Info	Public Info	Public Info		
Site type(s)	General	General	General	General		
11 - (-)	Background	Background	Background	Background		
Mfg/ Model	TAPI 400e	TAPI 200e	TEI 43i	BAM 1020		
Method Code	087	099	060	122		
FRM/FEM or other	FEM	FRM	FEM	FEM		
Collecting Agency	Santa	Santa	Santa	Santa		
ggy	Barbara	Barbara	Barbara	Barbara		
	County	County	County	County		
Reporting Agency	Santa	Santa	Santa	Santa		
	Barbara	Barbara	Barbara	Barbara		
	County	County	County	County		
Spatial Scale	Regional	Regional	Regional	Neighborhoo		
•	5	5	5	ď		
Start date	6/1/78	6/1/78	6/1/78	6/1/78		
Operation schedule	Continuous	Continuous	Continuous	Continuous		
Sampling season	All Year	All Year	All Year	All Year		
Probe height	3.8 m	3.8 m	3.8 m	4.1 m		
Distance from	1.2 m	1.2 m	1.2 m	1.5 m		
supporting structure						
Distance from	None	None	None	None		
obstructions on roof						
Distance from	None	None	None	None		
obstructions not on						
roof						
Distance from trees	None	None	None	None		
Distance to furnace or	None	None	None	None		
incinerator						
Unrestricted airflow	360°	360°	360°	360°		
For low volume PM	NA	NA	NA	No		
instruments, is any PM						
instrument within 1 m						
of the lovol? If yes,						
please list distance						

(meters) and instrument(s).					
Probe material	Glass & Teflon	Glass & Teflon	Glass & Teflon	N/A	
Residence time	17.2 s	17.5 s	19.8 s	N/A	
Will there be changes in next 18 months?	No	No	No	No	
Frequency of flow rate verification for automated PM analyzers	N/A	N/A	N/A	Bi-Weekly	
Frequency of one- point QC check (gaseous)	Weekly	Weekly	Weekly	N/A	
Last annual performance evaluation (gaseous)	8/26/2015	8/26/2015	8/26/2015	N/A	
Last two semi-annual flow rate audits for PM monitors	N/A	N/A	N/A	3/10/2015 8/26/2015	

Note that THC was shut down on 1/1/15.

Table 5.3Ellwood Odor Monitoring Station Details

Site Name	Ellwood Odor							
AQS ID	060831032							
GIS coordinates	34.430361 -119	.89755						
Location	Located in a vehicle storage lot							
Address	Hollister Ave, Goleta, CA							
County	Santa Barbara County							
Dist. to road		meters; HWY101	200 meters					
Traffic count (AADT,		937 (1999) Hwy 1		2013)				
year)		007 (1000) 1 My	101 00,200 (2010)				
Groundcover	Asphalt							
Representative area		bara – Santa Ma	ria CA)					
Pollutant, POC	H2S,1	TRS,1						
Monitor Type	SPM	SPM						
Network Affiliation	PSD	PSD						
Parameter Code	42402	43911						
Monitoring Objective	Public Info	Public Info						
Site type(s)	Source	Source		1				
MFG/ Model	ML 8850	TEI 43i						
Method Code		020						
FRM/FEM or other	020 N/A	020 N/A		+				
Collecting Agency	Consultant Consultant							
Reporting Agency	Santa Barbara County	ra Santa Barbara County						
Spatial Scale	Neighborhood Neighborhood							
Start date	4/1/00 4/1/00							
Operation schedule	Continuous	ntinuous Continuous						
Sampling season	All Year	All Year						
Probe height	3.5	3.5						
Distance from	3.5 1.1	1.1						
supporting structure								
Distance from	None	None						
obstructions on roof								
Distance from	None	None						
obstructions not on								
roof								
Distance from trees	None	None						
Distance to furnace or	None	None						
incinerator								
Unrestricted airflow	360°	360°						
Probe material	Glass & Teflon	Glass & Teflon		1				
Residence time	14.9 s	14.9 s		1				
Will there be changes	No	No		1				
in next 18 months?								
Frequency of one-	Bi-Weekly Bi-Weekly							
point QC check	-							
(gaseous)								
Last annual	9/10/2015	9/10/2015						
performance								
evaluation (gaseous)								
Note: Site temporarily		100/4 5		•	•			

Note: Site temporarily shut down 10/22/15

Table 5.4 Goleta Monitoring Station Details

Site Name	Goleta							
AQS ID	060832011	060832011						
GIS coordinates	34.4455 -119.	828333						
Location		Lutheran Chu	ırch					
Address		w Ave., Goleta						
County	Santa Barbara							
Dist. to road			airview Ave, 200 n	neters: Alli Wav 1	00 meters			
Traffic count (AADT,	Fairview - 12546 (2003); Berkley Rd - 3480 (2003); Ali Way - 25 est.							
year)		(),						
Groundcover	Grass	Grass						
Representative area		Barbara – Sant	a Maria, CA)					
Pollutant, POC	03,1	NO2,1	CO,1	PM10,1	PM2.5 ,1			
Monitor Type	SLAMS	SLAMS	SLAMS	SLAMS	SLAMS			
Network Affiliation	NA	NA	NA	NA	NA			
Parameter Code	44201	42602	42101	81102	88101			
Monitoring Objective	NAAQS,	NAAQS,	NAAQS,	NAAQS,	NAAQS,			
Monitoring Objective	Public Info	Public Info	Public Info	Public Info	public Info			
Site type(s)	Population	Population	Population	Population	Population			
MFG/ Model	TAPI 400e	TAPI 200e	TAPI 300e	BAM 1020	BAM 1020			
Method Code	087	099	093	122	170			
FRM/FEM or other	FEM	FRM	FRM	FEM	FEM			
Collecting Agency	Santa	Santa	Santa Barbara	Santa Barbara	Santa			
Concounty / geney	Barbara	Barbara	County	County	Barbara			
	County	County	County	County	County			
Reporting Agency	Santa	Santa	Santa Barbara	Santa Barbara	Santa			
Reporting Agency	Barbara	Barbara	County	County	Barbara			
	County	County	County	County	County			
Spatial Scale	Urban	Urban	Neighborhood	Neighborhood	Neighborhood			
Start date	1/1/1980	1/1/1992	5/1/1982	1/1/10	1/1/10			
Operation schedule	Continuous	Continuous	Continuous	Continuous	Continuous			
Sampling season	All Year	All Year	All Year	All Year	All Year			
Probe height	4.5 m	4.5 m	4.5 m	7.0 m	7.0 m			
Distance from	2.1 m	2.1 m	2.1 m	2.0 m	2.0 m			
supporting structure				2.0	2.0			
Distance from	None	None	None	None	None			
obstructions on roof								
Distance from	None	None	None	None	None			
obstructions not on								
roof								
Distance from trees	None	None	None	None	None			
Distance to furnace or	None	None	None	None	None			
incinerator			-	-	-			
Unrestricted airflow	360°	360°	360°	360°	360°			
For low volume PM	NA	NA	NA	No	No			
instruments, is any PM								
instrument within 1 m								
of the lovol? If yes,								
please list distance								
(meters) and								
instrument(s).								
Probe material	Glass &	Glass &	Glass & Teflon	N/A	N/A			
	Teflon	Teflon						

Residence time	18.1 s	18.3 s	15.1 s	N/A	N/A
Will there be changes in next 18 months?	No	No	No	No	No
Frequency of one- point QC check (gaseous)	Weekly	Weekly	Weekly	N/A	N/A
Frequency of flow rate verification for automated PM analyzers	N/A	N/A	N/A	Bi-Weekly	Bi-Weekly
Last annual performance evaluation (gaseous)	5/5/2015	5/5/2015	5/5/2015	N/A	N/a
Last two semi-annual flow rate audits for PM monitors				5/5/2015 11/18/15	5/5/2015 11/18/15
Is it suitable for comparison against the annual PM2.5?	N/A	N/A	N/A	N/A	Yes

Note: PM2.5 was changed from Non-FEM (88501) to FEM (88101) on January 1, 2014. EPA approved this network modification on May 22, 2015 (See Appendix B)

Table 5.5Las Flores Canyon #1 Monitoring Station Details

Site Name	Las Flores Canyon #1								
AQS ID	060831025								
GIS coordinates	34.48975 -12	20.046917							
Location		canyon behind ar	n oil and gas facili	tv					
Address		S Hwy 101, El Ca		-)					
County	Santa Barba								
Dist. to road	HWY 101, 28								
Traffic count (AADT,		Hwy 101 - 30,200 (2013)							
year)		,,200 (2010)							
Groundcover	Grass and di	rt							
Representative area		Barbara – Santa	Maria CA)						
Pollutant, POC	O3,1	NO2,1	SO2,1	CO,1	PM10,3				
Monitor Type	SPM	SPM	SPM	SPM	SPM				
Network Affiliation	PSD	PSD	PSD	PSD	PSD				
Parameter Code	44201	42602	42401	42101	81102				
Monitoring Objective	NAAQS,	NAAQS,	NAAQS,	NAAQS,	NAAQS,				
	public	public	public	public	public				
Site type(s)	Max O3	Source	Source	Source	Source				
	conc.	Cource		Course					
MFG/ Model	TAPI 400e	TAPI 200e	TEI 43i	TEI 48i	BAM 1020				
Method Code	087	099	060	054	122				
FRM/FEM or other	FEM	FRM	FEM	FRM	FEM				
Collecting Agency	Santa	Santa Barbara	Santa Barbara	Santa Barbara	Santa Barbara				
Concerning Agency	Barbara	County	County	County	County				
	County	Obdinty	Obunty	Obunty	Obunty				
Reporting Agency	Santa	Santa Barbara	Santa Barbara	Santa Barbara	Santa Barbara				
i toporting / tgorioy	Barbara	County	County	County	County				
	County	000	000	000	000				
Spatial Scale	Regional	Neighborhood	Neighborhood	Neighborhood	Neighborhood				
Start date	4/1/88	4/1/88	4/1/88	4/1/88	4/1/88				
Operation schedule	Continuous	Continuous	Continuous	Continuous	Continuous				
Sampling season	All Year	All Year	All Year	All Year	All Year				
Probe height	3.5 m	3.5 m	3.5 m	3.5 m	4.0 m				
Distance from	1.2 m	1.2 m	1.2 m	1.2 m	1.0 m				
supporting structure									
Distance from	None	None	None	None	None				
obstructions on roof									
Distance from	None	None	None	None	None				
obstructions not on									
roof									
Distance from trees	None	None	None	None	None				
Distance to furnace or	None	None	None	None	None				
incinerator	_	-	_	-	_				
Unrestricted airflow	360°	360°	360°	360°	360°				
For low volume PM	NA	NA	NA	NA	No				
instruments, is any PM					-				
instrument within 1 m									
of the lovol? If yes,									
please list distance									
(meters) and									
instrument(s).		1							

Probe material	Glass & Teflon	Glass & Teflon	Glass & Teflon	Glass & Teflon	N/A
Residence time	12.8 s	15.8 s	14.2 s	11.9 s	N/A
Will there be changes in next 18 months?	No	No	No	No	No
Frequency of flow rate verification for automated PM samplers	N/A	N/A	N/A	N/A	Bi-Weekly
Frequency of one- point QC check (gaseous)	Weekly	Weekly	Weekly	Weekly	N/A
Last annual performance evaluation (gaseous)	4/21/2015	4/21/2015	4/21/2015	4/21/2015	N/A
Last two semi-annual flow rate audits for PM monitors	N/A	N/A	N/A	N/A	4/21/2015 11/18/2015

Note: Las Flores Canyon#1 PM10 monitor is classified as Neighborhood Scale due to the dominant source being the nearby oil and gas facility.

Table 5.6

Las Flores Canyon Odor Monitoring Station Details

Site Name	Las Flores Cany	on Odor					
AQS ID	060831037						
GIS coordinates	34.464528 -120.0	34.464528 -120.044972					
Location	Located in a parking lot at the entrance to Las Flores Canyon						
Address	Calle Real US H			, .			
County	Santa Barbara C						
Dist. to road	HWY 101,75 met		al 44 meters l	as Flores Canvor	n Rd???		
Traffic count (AADT,	Hwy 101 - 30,200						
vear)	11119 101 00,200	2010)					
Groundcover	Gravel						
Representative area	MSA (Santa Bart	oara – Santa I	Maria CA)				
Pollutant, POC	H2S,1						
Monitor Type	SPM						
Network Affiliation	PSD						
Parameter Code	42402						
Monitoring Objective	Public						
Site type(s)	Source						
MFG/ Model	API 101e						
Method Code							
	020 N/A						
FRM/FEM or other							
Collecting Agency	Santa Barbara						
Departing Agapay	County Santa Barbara						
Reporting Agency							
Cratic Casta	County						
Spatial Scale	Neighborhood						
Start date	2/1/88						
Operation schedule	Continuous						
Sampling season	All Year						
Probe height	3.5						
Distance from	1.1						
supporting structure							
Distance from	None						
obstructions on roof							
Distance from	None						
obstructions not on							
roof	NL						
Distance from trees	None						
Distance to furnace or	None						
incinerator	2000						
Unrestricted airflow	360°						
Probe material	Glass & Teflon						
Residence time	16.1 s			-			
Will there be changes	No						
in next 18 months?	14/						
Frequency of one-	Weekly						
point QC check							
(gaseous)	40/04/0045						
Last annual	10/21/2015						
performance							
evaluation (gaseous)							

Table 5.7 Lompoc HS&P Monitoring Station Details

Site Name	Lompoc HS&P						
AQS ID	060831013						
GIS coordinates	34.725331 -120.4	428689					
Location	Located North of	Lompoc near an c	il processing faci	lity			
Address		le Rd, Lompoc, CA		2			
County	Santa Barbara C						
Dist. to road	Harris Grade Roa						
Traffic count (AADT,	Harris Grade Roa						
year)							
Groundcover	Dirt						
Representative area	MSA (Santa Bart	oara – Santa Maria	I, CA)				
Pollutant, POC	O3,1	NO2,1	SO2,1	THC,1			
Monitor Type	SPM	SPM	SPM	SPM			
Network Affiliation	PSD	PSD	PSD	PSD			
Parameter Code	44201	42602	42401	43101			
Monitoring Objective	NAAQS, public	NAAQS, public	NAAQS,	Public			
3			public				
Site type(s)	General	Source	Source	Source			
	Background						
MFG/ Model	TEI 49i	TEI 42c	TEI 43i	TEI 51 Clt			
Method Code	047	074	060	011			
FRM/FEM or other	FEM	FRM	FEM	N/A			
Collecting Agency	Consultant	Consultant	Consultant	Consultant			
Reporting Agency	Santa Barbara	Santa Barbara	Santa Barbara	Santa Barbara			
	County	County	County	County			
Spatial Scale	Regional	Neighborhood	Neighborhood	Neighborhood			
Start date	1/1/86	1/1/86	1/1/86	1/1/86			
Operation schedule	Continuous	Continuous	Continuous	Continuous			
Sampling season	All Year	All Year	All Year	All Year			
Probe height	4.7	4.7	4.7	4.7			
Distance from supporting	1.6	1.6	1.6	1.6			
structure							
Distance from	None	None	None	None			
obstructions on roof							
Distance from	None	None	None	None			
obstructions not on roof							
Distance from trees	None	None	None	None			
Distance to furnace or	None	None	None	None			
incinerator							
Unrestricted airflow	360°	360°	360°	360°			
Probe material	Glass & Teflon	Glass & Teflon	Glass & Teflon	Glass & Teflon			
Residence time	6.7 s	6.7 s	7.4 s	9.5 s			
Will there be changes in	No	No	No	No			
next 18 months?							
Frequency of one-point	Bi-weekly	Bi-weekly	Bi-Weekly	Bi-Weekly			
QC check (gaseous)							
Last annual performance	12/2/2015	12/2/2015	12/2/2015	12/2/2015			
evaluation (gaseous)							

Table 5.8Lompoc H Street Monitoring Station Details

Site Name	Lompoc H Street							
AQS ID	060832004							
GIS coordinates		34.637833 -120.4575						
Location		Parking lot behind gas company						
Address	128 S. H Street, Lompoc CA 93436							
County		Santa Barbara County						
Dist. to road			57 motors: Oc	2000 Avo 120 m	notors: Alloy 13	motors		
Traffic count (AADT,	H Street, 28 meters; E. Cyprus, 57 meters; Ocean Ave, 120 meters; Alley,13 meters Ocean Ave (Hwy 246) - 11200 (2013); H Street 12900 (2010); Cyprus - 500 est.; Alley - 20							
year)	est.	wy 240) - 11200	(2013), n Silee	12900 (2010)	, Cyprus - 500 e	est., Alley - 20		
yeary	030							
Groundcover	Asphalt							
Representative area		arbara – Santa	Maria CA)					
Pollutant, POC	03,1	NO2,1	SO2,1	CO,1	PM10,2	PM2.5,1		
	00,1	1102,1	002,1	00,1	1 11 10,2	1 1112.0,1		
Monitor Type	SLAMS	SLAMS	SLAMS	SLAMS	SLAMS	SLAMS		
Network Affiliation	NA	NA	NA	NA	NA	NA		
Parameter Code	44201	42602	42401	42101	81102	88101		
Monitoring Objective	NAAQS,	NAAQS,	NAAQS,	NAAQS,	NAAQS,	NAAQS,		
	Public	Public	Public	Public	Public	public		
Site type(s)	Population	Population	Population	Population	Population	Population		
MFG/ Model	TAPI 400e	TEI 42i	TEI 43i	TEI 48i	BAM 1020	BAM 1020		
	087	074	060	054	122			
Method Code						170		
FRM/FEM or other	FEM	FRM	FEM	FRM	FEM	FEM		
Collecting Agency	Santa	Santa	Santa	Santa	Santa	Santa		
	Barbara	Barbara	Barbara	Barbara	Barbara	Barbara		
	County	County	County	County	County	County		
Reporting Agency	Santa	Santa	Santa	Santa	Santa	Santa		
	Barbara	Barbara	Barbara	Barbara	Barbara	Barbara		
	County	County	County	County	County	County		
Spatial Scale	Neighborhood	Neighborhood	Neighborhood	Neighborhood	Neighborhood	Neighborhood		
Start date	1/1/84	5/1/91	1/1/84	1/1/84	8/1/09	9/1/08		
Operation schedule	Continuous	Continuous	Continuous	Continuous	Continuous	Continuous		
Sampling season	All Year	All Year	All Year	All Year	All Year	All Year		
Probe height	5.3 m	5.3 m	5.3 m	5.3 m	5.4 m	5.4 m		
Distance from	1.3 m	1.3 m	1.3 m	1.3 m	1.4 m	1.4 m		
supporting structure								
Distance from	None	None	None	None	None	None		
obstructions on roof								
Distance from	15 m/1 m	15 m/1 m	15 m/1 m	15 m/1 m	15 m/1 m	15 m/ 1 m		
obstructions not on								
roof/Obs. Height								
above inlet								
Distance from trees	None	None	None	None	None	None		
Distance to furnace or	None	None	None	None	None	None		
incinerator								
Unrestricted airflow	360°	360°	360°	360°	360°	360°		
For low volume PM	NA	NA	NA	NA	No	No		
instruments, is any PM								
instrument within 1 m								
of the lovol? If yes,								

(meters) and instrument(s).						
Probe material	Glass & Teflon	Glass & Teflon	Glass & Teflon	Glass & Teflon	N/A	N/A
Residence time	14.1 s	16.4 s	17.2 s	14.9 s	N/A	N/A
Will there be changes in next 18 months?	No	No	No	No	No	No
Is it suitable for comparison against the annual PM2.5?	N/A	N/A	N/A	N/A	N/A	No
Frequency of flow rate verification for manual PM samplers	N/A	N/A	N/A	N/A	N/A	N/A
Frequency of flow rate verification for automated PM analyzers	N/A	N/A	N/A	N/A	Bi-Weekly	Bi-Weekly
Frequency of one- point QC check (gaseous)	Weekly	Weekly	Weekly	Weekly	N/A	N/A
Last annual performance evaluation (gaseous)	12/17/2015	12/17/2015	12/17/2015	12/17/2015	N/A	N/A
Last two semi-annual flow rate audits for PM monitors	N/A	N/A	N/A	N/A	6/3/2015 12/17/2015	6/3/2015 12/17/2015
Is it suitable for comparison against the annual PM2.5?	N/A	N/A	N/A	N/A	N/A	No

Note:1) PM2.5 was changed from non-FEM (88501) to FEM (88101) on January 1, 2015. EPA approved this network modification on May 22, 2015 (See

Appendix B).

2) NO2 monitor was changed from TAPI 200e to TEI 42i on 3/24/15.

3) PM10 and PM2.5 spatial scale was incorrectly listed as micro in the 2015 ANP based on incorrect traffic counts/distances. Based on correct counts/distances these monitors are now correctly listed as neighborhood spatial scale.

Table 5.9Lompoc Odor Monitoring Station Details

Site Name	Lompoc Odor					
AQS ID	060831022					
GIS coordinates	34.718992 -120.432761					
Location	Located near an oil processing facility					
Address		de Rd, Lompoc, (
County	Santa Barbara (5/(50-100			
Dist. to road	Harris Grade Ro					
Traffic count (AADT,	Harris Grade Ro					
year)		au - 100 est				
Groundcover	Dirt					
Representative area		bara – Santa Ma	ria CA)			
Pollutant, POC	H2S,1	TRS,1				
Monitor Type	SPM	SPM				
Network Affiliation	PSD	PSD				
Parameter Code	42402	43911				
	Public	Public				
Monitoring Objective	Source	Source		+		
Site type(s)						
MFG/ Model	TEI 45C	TEI 43i				
Method Code	020	020				
FRM/FEM or other	N/A	N/A				
Collecting Agency	Consultant	Consultant				
Reporting Agency	Santa Barbara County	Santa Barbara County				
Spatial Scale	Neighborhood	Neighborhood				
Start date	2/1/88	2/1/88				
Operation schedule	Continuous	Continuous				
Sampling season	All Year	All Year				
Probe height	3.5	3.5				
Distance from	1.1	1.1				
supporting structure						
Distance from	None	None				
obstructions on roof						
Distance from	None	None				
obstructions not on						
roof						
Distance from trees	None	None				
Distance to furnace or	None	None				
incinerator						
Unrestricted airflow	360°	360°				
Probe material	Glass & Teflon	Glass & Teflon				
Residence time	8.8 s	8.8 s				
Will there be changes	No	No				
in next 18 months?						
Frequency of one-	Bi-Weekly	Bi-Weekly				
point QC check		,				
(gaseous)						
Last annual	12/3/2015	12/3/2015				
performance						
evaluation (gaseous)	1		1	1		

Table 5.10 Nojoqui Monitoring Station Details

Site Name	Nojoqui						
AQS ID	060831018						
GIS coordinates		34.527472 -120.1965					
Location	Located at the top of Nojoqui pass just off of US Hwy 101						
Address		US Hwy 101 & Nojoqui Pass, Gaviota Ca 93117					
County	Santa Barbara						
Dist. to road	HWY 101,60 m						
Traffic count (AADT,	Hwy 101 - 237						
year)	1100 201	00 (2010)					
Groundcover	Grass						
Representative area		arbara – Santa N	Aaria CA)				
Pollutant, POC	03,1	NO2,1					
Monitor Type	SPM	SPM					
Network Affiliation	PSD	PSD					
Parameter Code	44201	42602					
Monitoring Objective	NAAQS,	NAAQS,					
	Public	Public					
Site type(s)	Transport,	Transport,					
	background	background					
MFG/ Model	TAPI 400e	TEI 42i					
Method Code	087	074					
FRM/FEM or other	FEM	FRM					
Collecting Agency	Santa Barbara	Santa Barbara					
	County	County					
Reporting Agency	Santa Barbara	Santa Barbara					
On atial Carola	County	County					
Spatial Scale	Regional	Regional					
Start date	7/1/87	7/1/87					
Operation schedule	Continuous	Continuous					
Sampling season	All Year	All Year					
Probe height	3.0 m	3.0 m					
Distance from	1.0 m	1.0 m					
supporting structure	NL	N					
Distance from	None	None					
obstructions on roof	Nere	None					
Distance from	None	None					
obstructions not on							
roof	Nene	Nono					
Distance from trees	None	None					
Distance to furnace or	None	None					
incinerator	2600	2600					
	Teflon	Teflon					
Residence time							
	Weeklv	Weeklv					
Unrestricted airflow Probe material Residence time Will there be changes in next 18 months? Frequency of one- point QC check (gaseous)	360° Glass & Teflon 17.6 s No Weekly	360° Glass & Teflon 19.3 s No Weekly					

Last annual	8/24/2015	8/24/2015		
performance				
evaluation (gaseous)				

Table 5.11Paradise Road Monitoring Station Details

Site Name	Paradise Road				
AQS ID	060831014				
GIS coordinates	34,544436 -119,791464				
Location	Located in Los Padres National Forest off of Paradise Rd				
Address		Los Padres Nation			
County	Santa Barbara C				
Dist. to road	Paradise Rd.,100				
Traffic count (AADT,	Paradise Rd - 10				
year)					
Groundcover	Trees and brush				
Representative area		bara – Santa Maria	a. CA)		
Pollutant, POC	03,1	NO2,1			
Monitor Type	SPM	SPM			
Network Affiliation	PSD	PSD			
Parameter Code	44201	42602			
Monitoring Objective	NAAQS, Public	NAAQS, Public		1	
Site type(s)	Max O3 Conc.	Background		1	
MFG/ Model	TEI 49i	TEI 42i		1	
Method Code	047	074		1	
FRM/FEM or other	FEM	FRM			
Collecting Agency	Consultant	Consultant			
Reporting Agency	Santa Barbara	Santa Barbara			
	County	County			
Spatial Scale	Regional	Regional			
Start date	1/1/86	1/1/86			
Operation schedule	Continuous	Continuous			
Sampling season	All Year	All Year			
Probe height	5.0 m	5.0 m			
Distance from	1.8 m	1.8 m			
supporting structure					
Distance from	None	None			
obstructions on roof					
Distance from	None	None			
obstructions not on					
roof					
Distance from trees	20 m	20 m			
Distance to furnace or	None	None			
incinerator					
Unrestricted airflow	360°	360°			
Probe material	Glass & Teflon	Glass & Teflon			
Residence time	15.6 s	14.1 s			
Will there be changes in next 18 months?	No	No			
Frequency of one- point QC check (gaseous)	Bi-weekly	Bi-weekly			
Last annual performance evaluation (gaseous)	11/11/2015	11/11/2015			

Table 5.12

Santa Barbara Monitoring Station Details

Site Name	Santa Barba	ra					
AQS ID	060830011						
GIS coordinates	34.427711 -1	19.690844					
Location		of the National G	Guard Armory				
Address		700 E. Canon Perdido, Santa Barbara CA 93103					
County		Santa Barbara County					
Dist. to road		De La Guerra, 7meters; N Quarantina, 85 meters; N. Nopal, 60 meters; E.					
		Canon Perdido, 140 meters; N. Milpas, 200 meters					
Traffic count (AADT, year)	De La Guerra	De La Guerra - 4500 (1996); Canon Perdido - 7300 (1996); Quarantina - 100 est.; Milpas - 14600 (1996)					
Groundcover	Asphalt						
Representative area	MSA (Santa	Barbara – Santa	Maria, CA)				
Pollutant, POC	O3,1	NO2,1	CO,3	PM2.5,3	PM10,1		
Monitor Type	SLAMS	SLAMS	SLAMS	SLAMS	SLAMS		
Network Affiliation	NA	NA	NA	NA	NA		
Parameter Code	44201	42602	42101	88101	81102		
Monitoring Objective	NAAQS,	NAAQS,	NAAQS,	NAAQS,	NAAQS,		
5.	public	public	public	public	public		
Site type(s)	population	High	High	Highest	population		
		concentration	concentration	concentration			
MFG/ Model	TAPI 400	TAPI 200	TAPI 300eu	BAM 1020	BAM 1020		
Method Code	087	099	593	170	122		
FRM/FEM or other	FEM	FRM	FRM	FEM	FEM		
Collecting Agency	CARB	CARB	CARB	CARB	CARB		
Reporting Agency	CARB	CARB	CARB	CARB	CARB		
Spatial Scale	Urban	Neighborhood	Middle Scale	Neighborhood	Neighborhoo d		
Start date	5/1/02	5/1/02	5/1/02	7/1/10	5/1/02		
Operation schedule	Continuous	Continuous	Continuous	Continuous	Continuous		
Sampling season	All Year	All Year	All Year	All Year	All Year		
Probe height	6.0 m	6.0 m	6.0 m	7.0 m	7.0 m		
Distance from	2.5 m	2.5 m	2.5 m	2.0 m	2.0 m		
supporting structure							
Distance from obstructions on roof	None	None	None	None	None		
Distance from	None	None	None	None	None		
obstructions not on							
roof							
Distance from trees	None	None	None	None	None		
Distance to furnace or incinerator	None	None	None	None	None		
Unrestricted airflow	360°	360°	360°	360°	360°		
For low volume PM	NA	NA	NA	No	No		
instruments, is any PM							
instrument within 1 m							
of the lovol? If yes,							
please list distance							
(meters) and							
instrument(s).							
Probe material	Glass &	Glass &	Glass &	N/A	N/A		
	Teflon	Teflon	Teflon				

Residence time	7.0 s	8.1 s	5.6 s	N/A	N/A
Will there be changes in next 18 months?	No	No	No	No	No
Frequency of one- point QC check (gaseous)	Weekly	Weekly	Weekly		
Frequency of flow rate verification for automated PM analyzers				Bi-Weekly	Bi-Weekly
Last annual performance evaluation (gaseous)	4/22/2015	4/22/2015	4/14/2015		
Last two semi-annual flow rate audits for PM monitors				4/22/2015 *	4/22/2015 *
Is it suitable for comparison against the annual PM2.5?	N/A	N/A	N/A	Yes	N/A

Note: This site is owned and operated by CARB. Data in this table are provided for reference only. CARB added PM10 STP (81102 method 122) in June 2013.

* The second semi-annual flow rate audit for PM could not be completed due to the temporary suspension of PM monitoring at this site.

Table 5.13Santa Maria Monitoring Station Details

Site Name	Santa Maria						
AQS ID	060831008						
GIS coordinates	34.942864 -12	20.435625					
Location			nall office buildi	na			
Address		vay, Santa Mar					
County		Santa Barbara County					
Dist. to road		S. Broadway,25 meters; W. Morrison, 25 meters; El Camino Colegio, 120					
		elland St., 100 r			510g10, 120		
Traffic count (AADT,				6 (2010); El Camir	o Colegio 769		
year)		elland - 500 (est		5 (2010), El Odilli	lo oblegio 700		
<i>y</i> = <i>u</i> , <i>y</i>	(),		,				
Groundcover	Roof						
Representative area		Barbara – Santa	Maria, CA)				
Pollutant, POC	O3,1	NO2,1	CO, 1	PM10,2	PM2.5, 3		
Monitor Type	SLAMS	SLAMS	SLAMS	SLAMS	SLAMS		
Network Affiliation	NA	NA	NA	NA	NA		
Parameter Code	44201	42602	42101	81102	88101		
Monitoring Objective	NAAQS,	NAAQS,	NAAQS,	NAAQS,	NAAQS,		
	public	public	public	public	public		
Site type(s)	Population	Population	Highest	Population	Population		
	ropulation	ropulation	Conc.	ropulation	ropulation		
MFG/ Model	TAPI 400	TAPI 200	TAPI	BAM 1020	BAM 1020		
	17411400	17411200	T300eu	B/(W 1020	B/ (W 1020		
Method Code	087	099	593	122	170		
FRM/FEM or other	FEM	FRM	FRM	FEM	FEM		
Collecting Agency	CARB	CARB	CARB	CARB	CARB		
Reporting Agency	CARB	CARB	CARB	CARB	CARB		
Spatial Scale	Urban	Urban	Middle	Neighborhood	Neighborhood		
Spatial Scale	Ofball	Orban	Scale	Neighborhood	Neighborhood		
Start date	5/1/99	5/1/99	5/1/99	7/1/09	7/1/10		
Operation schedule	Continuous	Continuous	Continuous	Continuous	Continuous		
Sampling season	All Year	All Year	All Year	All Year	All Year		
Probe height	9.0 m	9.0 m	9.0 m	7.0 m	9.0 m		
Distance from	3.0 m	3.0 m	3.0 m	2.0 m	2.0 m		
supporting structure	3.0 11	3.0 11	3.0 11	2.0 111	2.0 111		
Distance from	None	None	None	None	None		
obstructions on roof	None	None	None	None	None		
Distance from	None	None	None	None	None		
obstructions not on	None	NONE	None	None	None		
roof							
Distance from trees	None	None	None	None	None		
Distance to furnace or	None	None	None	None	None		
incinerator	NONE	NONE	NONE	NULLE	NONE		
Unrestricted airflow	360°	360°	360°	360°	360°		
For low volume PM	NA	NA	NA	No	No		
instruments, is any PM				NO			
instrument within 1 m							
of the lovol? If yes,							
please list distance							
(meters) and							
(1		1		1		

Probe material	Glass & Teflon	Glass & Teflon	Glass & Teflon	N/A	N/A
Residence time	8.2 s	10.5 s	5.0 s	N/A	N/A
Will there be changes in next 18 months?	No	No	No	No	No
Frequency of one- point QC check (gaseous)	Weekly	Weekly	Weekly		
Frequency of flow rate verification for automated PM analyzers				Bi-Weekly	Bi-Weekly
Last annual performance evaluation (gaseous)	12/16/2015	12/16/2015	4/14/2015		
Last two semi-annual flow rate audits for PM monitors				6/2/2015 12/16/2015	6/2/2015 12/16/2015
Is it suitable for comparison against the annual PM2.5?	N/A	N/A	N/A	N/A	Yes

Note: This site is owned and operated by CARB. Data in this table are provided for reference only. CARB added PM10 STP (81102 method 122) in June 2013.

Table 5.14Santa Ynez Monitoring Station Details

Site Name	Santa Ynez			
AQS ID	060833001			
GIS coordinates	34.605819 -120.075069			
Location	South side of Santa Ynez airport runway			
Address	900 Airport Rd.,			
County	Santa Barbara			
Dist. to road	HWY 246, 550			
Traffic count (AADT,	Hwy 246 - 8050			
year)	1100 240 - 0030	(2013)		
Groundcover	Grass/Dirt			
		rhara Santa	Maria (CA)	
Representative area Pollutant, POC	MSA (Santa Ba	Ibara – Santa	Maria, CA)	
	03,1			
Monitor Type	SLAMS			
Network Affiliation	NA			
Parameter Code	44201			
Monitoring Objective	NAQQS,			
	public			
Site type(s)	Population			
MFG/ Model	TAPI T400			
Method Code	087			
FRM/FEM or other	FEM			
Collecting Agency	Santa Barbara			
	County			
Reporting Agency	Santa Barbara			
	County			
Spatial Scale	Urban			
Start date	7/1/2013			
Operation schedule	Continuous			
Sampling season	All Year			
Probe height	3.5 m			
Distance from	1.0 m			
supporting structure				
Distance from	None			
obstructions on roof				
Distance from	None			
obstructions not on				
roof				
Distance from trees	None			
Distance to furnace or	None			
incinerator				
Unrestricted airflow	360°			
Probe material	Teflon			
Residence time	2.6 s		1	
Will there be changes	No		1	
in next 18 months?				
Frequency of one-	Weekly			
point QC check	VV CCNIY			
(gaseous)				
Last annual	5/11/2015			
performance	5/11/2015			
evaluation (gaseous)				
evaluation (yaseous)				

Table 5.15

UCSB West Campus Monitoring Station Details

Site Name	UCSB West Campus					
AQS ID	060831020	-				
GIS coordinates		34.414942 -119.879511				
Location		Located West of Deverouix slough near UCSB				
Address		mpus, Santa Barb				
County	Santa Barbara (
Dist. to road	Slough Road, 4					
Traffic count (AADT,	Slough Road - 5					
year)						
Groundcover	Grass					
Representative area		rbara – Santa Ma	ria, CA)			
Pollutant, POC	SO2,2	H2S,1	TRS,1	THC,1		
Monitor Type	SPM	SPM	SPM	SPM		
Network Affiliation	PSD	PSD	PSD	PSD		
Parameter Code	42401	42402	43911	43101		
Monitoring Objective	NAAQS,	Public	Public	Public		
	Public					
Site type(s)	Source	Source	Source	Source		
MFG/ Model	TEI 43i	TEI 43i	TEI 43i	51i-HT		
Method Code	060	020	020	011		
FRM/FEM or other	FEM	N/A	N/A	N/A		
Collecting Agency	Consultant	Consultant	Consultant	Consultant		
Reporting Agency	Santa Barbara	Santa Barbara	Santa Barbara	Santa Barbara		
	County	County	County	County		
Spatial Scale	Neighborhood	Neighborhood	Neighborhood	Neighborhood		
Start date	6/1/99	6/1/99	6/1/99	6/1/99		
Operation schedule	Continuous	Continuous	Continuous	Continuous		
Sampling season	All Year	All Year	All Year	All Year		
Probe height	3.5	3.5	3.5	3.5		
Distance from	1.1	1.1	1.1	1.1		
supporting structure						
Distance from	None	None	None	None		
obstructions on roof						
Distance from	None	None	None	None		
obstructions not on						
roof						
Distance from trees	None	None	None	None		
Distance to furnace or	None	None	None	None		
incinerator						
Unrestricted airflow	360°	360°	360°	360°		
Probe material	Glass & Teflon	Glass & Teflon	Glass & Teflon	Glass & Teflon		
Residence time	18.1 s	19.9.9 s	19.9 s	14.9 s		
Will there be changes	NO	No	No	No		
in next 18 months?						
Frequency of one-	Bi-Weekly	Bi-Weekly	Bi-Weekly	Bi-Weekly		
point QC check						
(gaseous)						
Last annual	11/12/2015	11/12/2015	11/12/2015	11/12/2015		
performance						
evaluation (gaseous)						

Table 5.16 VAFB STS Monitoring Station Details

Site Name	VAFB STS					
AQS ID	060834003	060834003				
GIS coordinates		34.595861 -120.63135				
Location		Coastal hillside east of a gas turbine peaking power plant				
Address		South VAFB, Vandenberg AFB, CA				
County		Santa Barbara County				
Dist. to road	Honda Ridge	Road, 580 mete	ers			
Traffic count (AADT,	Honda Ridge	Road - 250 est				
year)	-					
Groundcover	Grass					
Representative area	MSA (Santa E	<u> Barbara – Santa</u>			_	
Pollutant, POC	O3,1	NO2,1	SO2,1	CO,1	PM10,3	
Monitor Type	SPM	SPM	SPM	SPM	SPM	
Network Affiliation	PSD	PSD	PSD	PSD	PSD	
Parameter Code	44201	42602	42401	42101	81102	
Monitoring Objective	NAAQS,	NAAQS,	NAAQS,	NAAQS,	NAAQS,	
	Public	Public	Public	Public	Public	
Site type(s)	General	Source	Source	Source	Source	
	Background					
MRG/Model	TAPI 400e	TAPI 200e	TEI 43i	TAPI 300	BAM 1020	
Method Code	087	074	060	093	122	
FRM/FEM or other	FEM	FRM	FEM	FRM	FEM	
Collecting Agency	Santa	Santa	Santa Barbara	Santa	Santa	
	Barbara	Barbara	County	Barbara	Barbara	
	County	County		County	County	
Reporting Agency	Santa	Santa	Santa Barbara	Santa	Santa	
	Barbara	Barbara	County	Barbara	Barbara	
	County	County	Nie wiele endere al	County	County	
Spatial Scale	Regional	Neighborhood	Neighborhood	Neighborhood	Neighborhood	
Start date	6/1/88	6/1/88	6/1/88	6/1/88	6/1/88	
Operation schedule	Continuous All Year	Continuous	Continuous	Continuous	Continuous	
Sampling season		All Year	All Year	All Year	All Year	
Probe height	4.5 m 1.0 m	4.5 m	4.5 m	4.5 m	5.0 m	
Distance from	1.0 m	1.0 m	1.0 m	1.0 m	1.5 m	
supporting structure Distance from	None	None	None	None	None	
obstructions on roof	NULLE	NULLE	INDIE	NULLE	NOLIG	
Distance from	None	None	None	None	None	
obstructions not on	NONE	NONE	NONE	NONE	NONE	
roof						
Distance from trees	None	None	None	None	None	
Distance to furnace or	None	None	None	None	None	
incinerator						
Unrestricted airflow	360°	360°	360°	360°	360°	
For low volume PM	NA	NA	NA	NA	No	
instruments, is any PM						
instrument within 1 m						
of the lovol? If yes,						
please list distance						
(meters) and						
instrument(s).						

Probe material	Glass & Teflon	Glass & Teflon	Glass & Teflon	Glass & Teflon	N/A
Residence time	7.0 s	8.2 s	7.7 s	6.9 s	N/A
Will there be changes in next 18 months?	No	No	No	No	No
Frequency of flow rate verification for automated PM samplers	N/A	N/A	N/A	N/A	Bi-Weekly
Frequency of one- point QC check (gaseous)	Weekly	Weekly	Weekly	Weekly	N/A
Last annual performance evaluation (gaseous)	5/13/2015	5/13/2015	5/13/2015	5/13/2015	N/A
Last two semi-annual flow rate audits for PM monitors	N/A	N/A	N/A	N/A	5/13/2015 11/30/2015

Note: VAFB STS PM10 spatial scale is classified as Neighborhood due to the dominate source being the nearby power plant.

Glossary of Acronyms

AQS	Air quality system
ARB	Air Resources Board
ARM	Approved regional method
CARB	California Air Resources Board
CFR	Code of Federal Regulations
CO	Carbon monoxide
FEM	Federal equivalent method
FRM	Federal reference method
H2S	Hydrogen Sulfide
MSA	Metropolitan statistical area
NAAQS	National ambient air quality standard
NO2	Nitrogen dioxide
O3	Ozone
PM10	Particulate matter less than 10 microns in diameter
PM2.5	Particulate matter less than 2.5 microns in diameter
PSD	Prevention of significant deterioration
SBCAPCD	Santa Barbara County Air Pollution Control District
SLAMS	State and Local Air Monitoring Station
SO2	Sulfur dioxide
SPM	Special purpose monitor
THC	Total hydrocarbons
TRS	Total reduced sulfur
US EPA	United States Environmental Protection Agency

APPENDIX A

Regulatory language of 40 CFR 58.10

§ 58.10 Annual monitoring network plan and periodic network assessment.

(a)(1) Beginning July 1, 2007, the State, or where applicable local, agency shall adopt and submit to the Regional Administrator an annual monitoring network plan which shall provide for the establishment and maintenance of an air quality surveillance system that consists of a network of SLAMS monitoring stations including FRM, FEM, and ARM monitors that are part of SLAMS, NCore stations, STN stations, State speciation stations, SPM stations, and/or, in serious, severe and extreme ozone nonattainment areas, PAMS stations, and SPM monitoring stations. The plan shall include a statement of purposes for each monitor and evidence that siting and operation of each monitor meets the requirements of appendices A, C, D, and E of this part, where applicable. The annual monitoring network plan must be made available for public inspection for at least 30 days prior to submission to EPA.

(2) Any annual monitoring network plan that proposes SLAMS network modifications including new monitoring sites is subject to the approval of the EPA Regional Administrator, who shall provide opportunity for public comment and shall approve or disapprove the plan and schedule within 120 days. If the State or local agency has already provided a public comment opportunity on its plan and has made no changes subsequent to that comment opportunity, the Regional Administrator is not required to provide a separate opportunity for comment.

(3) The plan for establishing required NCore multi-pollutant stations shall be submitted to the Administrator not later than July 1, 2009. The plan shall provide for all required stations to be operational by January 1, 2011.

(b) The annual monitoring network plan must contain the following information for each existing and proposed site:

- (1) The AQS site identification number.
- (2) The location, including street address and geographical coordinates.
- (3) The sampling and analysis method(s) for each measured parameter.
- (4) The operating schedules for each monitor.

(5) Any proposals to remove or move a monitoring station within a period of 18 months following plan submittal.

(6) The monitoring objective and spatial scale of representativeness for each monitor as defined in appendix D to this part.

(7) The identification of any sites that are suitable and sites that are not suitable for comparison against the annual PM_{2.5}NAAQS as described in §58.30.

(8) The MSA, CBSA, CSA or other area represented by the monitor.

(c) The annual monitoring network plan must document how States and local agencies provide for the review of changes to a PM_{2.5} monitoring network that impact the location of a violating PM_{2.5} monitor or the creation/change to a community monitoring zone, including a description of the proposed use of spatial averaging for purposes of making comparisons to the annual PM_{2.5} NAAQS as set forth in appendix N to part 50 of this chapter. The affected State or local agency must document the process for obtaining public comment and include any comments received through the public notification process within their submitted plan.

(d) The State, or where applicable local, agency shall perform and submit to the EPA Regional Administrator an assessment of the air quality surveillance system every 5 years to determine, at a minimum, if the network meets the monitoring objectives defined in appendix D to this part, whether new sites are needed, whether existing sites are no longer needed and can be terminated, and whether new technologies are appropriate for incorporation into the ambient air monitoring network. The network assessment must consider the ability of existing and proposed sites to support air quality characterization for areas with relatively high populations of susceptible individuals (e.g., children with asthma), and, for any sites that are being proposed for discontinuance, the effect on data users other than the agency itself, such as nearby States and Tribes or health effects studies. For PM2.5, the assessment also must identify needed changes to population-oriented sites. The State, or where applicable local, agency must submit a copy of this 5-year assessment, along with a revised annual network plan, to the Regional Administrator. The first assessment is due July 1, 2010.

(e) All proposed additions and discontinuations of SLAMS monitors in annual monitoring network plans and periodic network assessments are subject to approval according to §58.14.

APPENDIX B EPA Approval of PM2.5 Network Modification



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY REGION IX 75 Hawthorne Street San Francisco, Ca. 94105-3901

MAY 2 1 2015

Mr. Joel Cordes Air Monitoring Supervisor Santa Barbara County Air Pollution Control District 260 North San Antonio Road, Suite A Santa Barbara, California 93110-1315

Dear Mr. Cordes:

On March 19, 2015 we received Santa Barbara County Air Pollution Control District's (SBCAPCD) official request to change the monitor type for two Met One BAM 1020 PM_{2.5} monitors from SPM to FEM SLAMs monitors; one monitor at the Lompoc H Street (AQS ID: 06-083-2004) site located at 128 S. H Street, Lompoc, CA and one monitor at the Goleta (06-083-2011) site located at 380 N. Fairview Ave., Goleta, CA. Upon our review of the documentation you have provided, pursuant to 40 CFR 58.10 and 58.14, we approve your conversions of the Goleta and Lompoc PM_{2.5} SPM monitors to FEM SLAMS monitors beginning on January 1, 2014 and January 1, 2015, respectively.

We request that you submit data to AQS under the new parameter code 88101 and method code 170 as an FEM SLAMS PM_{2.5} monitor for both sites. Please update the monitor information in the 2015 Annual Ambient Air Quality Monitoring Network Plan and 2015 Network Assessment and refer to and attach this approval letter to the 2015 Annual Ambient Air Quality Monitoring Network Plan.

Thank you for your cooperation throughout this process and please feel free to contact Dena Vallano (415) 972-3134 from my staff or myself (415) 947-4534 with any questions or concerns in regards to this matter.

Sincerely,

Meredith Kurpius, Manager Air Quality Analysis Office

cc: Dave Van Mullem, Director, Santa Barbara County Air Pollution Control District cc: (via email)

Gayle Sweigert, California Air Resources Board Greg Gilani, California Air Resources Board Pheng Lee, California Air Resource Board

APPENDIX C Suspension of PM monitoring at Santa Barbara Armory Site

	-	-		
Joe	S	Co	rd	AC
JUCI			ıu	C 3

From:	Smith, Reginald@ARB < reginald.smith@arb.ca.gov>
Sent:	Friday, August 28, 2015 2:42 PM
To:	ARB (AQMIS); AirNowinfo@sonomatech.com; AMS-Notifications@valleyair.org; Joel S.
	Cordes; moritschm@sbcapcd.org; Contreas, Jaime@SLO; YOSHIMURA, GWEN
	(Yoshimura.Gwen@epa.gov)
Cc:	Benjamin, Michael@ARB; Stroud, Kenneth@ARB; Amador, Fernando@ARB
Subject:	Temporary suspension of cont. PM monitors at Oildale, San Luis Obispo-Higuera and Santa Barbara-Nat'l Guard

Data Clients:

The ARB is temporarily suspending operation of the following continuous PM monitors due to workplace safety concerns:


Oildale (060290232) - PM10 Santa Barbara-National Guard Armory (060830011) – PM10 and FEM PM2.5 San Luis Obispo-Higuera St (060792006) – PM10 and FEM PM2.5

Operation of the monitors above will resume once workplace safety concerns are addressed at each site. We apologize for this inconvenience and are expeditiously working to address these concerns.

Reggie Smith Manager, Operations and Data Support Section Air Quality Surveillance Branch Monitoring and Laboratory Division Air Resources Board 1927 13th Street Sacramento, CA 95811

Phone: (916) 327-1238 Fax: (916) 327-4718 Email: reginald.smith@arb.ca.gov

APPENDIX D Variance allowing temporary shutdown of Ellwood Odor

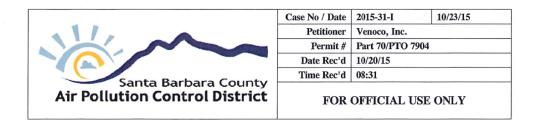

BEFORE THE HEARING BOARD OF THE SANTA BARBARA COUNTY AIR POLLUTION CONTROL DISTRICT

In The Matter of the Application of Venoco, Inc for an Interim Variance from District Rule 206, Condition 9.C.17 of Part 70/Permit to Operate 7904.

H.B. Case No. 2015-31-I

VARIANCE FINDINGS

AND ORDER

Venoco, Inc. filed a Petition for an Interim Variance on October 20, 2015. A hearing regarding the above-entitled matter was held on October 23, 2015 with John Garnett appearing for the Petitioner and Mike McKay appearing for the Santa Barbara County Air Pollution Control District.

This matter having been fully presented and duly considered, the Hearing Board makes the following findings and gives the following reasons for its decision.

)

- 1. Notice of the Hearing was duly given in the manner and for the time required by law.
- 2. Sworn testimony and argument on behalf of the Petitioner and the Air Pollution Control Officer were made, received and considered.
- 3. The Petitioner operates the equipment described in the Petition at the Ellwood Onshore Facility (EOF) located approximately 14 miles west of the City of Santa Barbara, California.
- 4. Venoco, Inc. is the holder of Permit to Operate 7904-R10. This main facility permit authorizes the operation of equipment and processes located at EOF which receives oil, water, and gas from Platform Holly and the Seep Containment Devices located on State Coastal Lease 3242.

SANTA BARBARA COUNTY APCD	<u>CASE</u> : 2015-31-I
HEARING BOARD VARIANCE ORDER	<u>DATE</u> : 10/23/15

- 5. The Petitioner's lease to operate the ambient monitoring station described in Table 9-7 of Part 70 Permit to Operate 7904-R10, will be terminated as of October 31, 2015 due to the property owners recently approved development plans. The Petitioner has been aware of these development plans since 2008 and has been aggressively and continuously working with the District to procure a new and acceptable location. Every parcel in the potential monitoring zone has been vetted. There are no property owners in that zone that are willing to lease space for this activity. The attached list and map show all locations that have been vetted since 2009. In addition to the inquiries, two separate ATC applications have been submitted and later fell through as well as tens of thousands of dollars being spent on this relocation effort. There is one location just outside of the monitoring zone that has not been denied. It is on the property of the Timbers Restaurant, located to the northeast of the EOF, on the north side of Highway 101. This location will continue to be examined, despite the fact that it is not within the desired corridor extending from the EOF to Ellwood School. The Petitioner has exercised due diligence up to this point to try and remain in compliance with their monitoring requirements.
- 6. Without variance protection, the Petitioner would be in violation of District Rule 206, Condition 9.C.17 of Part 70 Permit to Operate 7904-R10.
- 7. Due to conditions beyond the reasonable control of the Petitioner, returning to compliance at this time is not possible due to the inability to find property to install and operate the monitoring station. This would result in an arbitrary or unreasonable taking of property as the Petitioner would need to close their entire facility in order to comply.
- 8. Closing or taking would be without a corresponding benefit in reducing air contaminants as there are no expected excess emissions as a result of the granting of this Variance.
- 9. The Petitioner has curtailed operations in that the Petitioner has vetted all potential monitoring zone sites with no success to date.
- 10. There are no expected excess emissions with the granting of this Variance.
- 11. A nuisance as defined in District Rule 303 is not expected to occur as a result of this Variance and there is not a likely immediate threat or hazard to public health or safety.
- 12. The District staff supports the Petition as conditioned below.

SANTA BARBARA COUNTY APCD	CASE: 2015-31-I
HEARING BOARD VARIANCE ORDER	DATE: 10/23/15

THEREFORE, THE HEARING BOARD ORDERS, as follows:

That an Interim Variance be granted for not meeting the air station monitoring requirements for the Petitioner's EOF facility in violation of Rule 206, Condition 9.C.17 of Part 70/Permit to Operate 7904 from October 22, 2015 through January 19, 2016, or the date of decision on Petitioner's request for a Regular Variance, whichever occurs first, with the following conditions:

- 1. Petitioner shall submit a written report to the Hearing Board and District within 15 days of returning to compliance. The report shall include documentation showing the ability to remain in compliance with Condition 9.C.17.
- 2. Petitioner shall retain the obligation to comply with all other local, state and federal regulations not specifically referenced in the Order.
- 3. Failure to abide by all conditions of this Order shall subject the Petitioner receiving the variance to penalties set forth in Health and Safety Code §42402.
- 4. Each day during any portion of which a violation occurs is a separate offense.

DATED: 14/23/15

an

Donald R. Ward, Member Santa Barbara County Air Pollution Control District Hearing Board

The following locations have been evaluated for possible Ellwood odor monitoring station since 2009

- Existing Dixon property location, City has stated in writing will not allow station within proposed residential project planned for same site.
- Exxon parking lot and adjacent Dixon property; discussed with Exxon land person; NO

 Pat you followed up on this again with Dixon and Exxon recently, still NO
- The Ellwood School (back grassy maint area); NO. What area was considered by Tracer & APCD, school officials did not want the attractive nuisance. Any further south not acceptable by APCD.
- Sand Piper golf course maintenance shop area, discussed with property owner; NO
- Bacara rented lot for workers off of Hollister; NO
- Old Barnsdale gas station (historic site), discussed with land owner; NO
- SCE(Reliant) station empty lot considered wetlands, No trespassing; NO
- GenOn property adjacent to SCE Reliant Station; NO
- UPRR Right of Way significant diesel impact, not acceptable by Tracer or APCD; NO
- Empty lot across from Sandpiper, discussed with land owner; NO
- Future County Fire Station (City property), land area at new Hollister Ave. and Winchester Canyon Rd. 101 overpass. City indicated possibility, but unable to confirm as Fire Station placement is unapproved and design is unknown. NO
- Winchester Commons up from Timbers near 101. No response from landowner, however, APCD has essentially ruled out any locations on the north side of 101. NO
- Union Gas station (corner of Winchester Canyon Rd.), initial discussions with land owner were
 positive then discussions broke down. APCD visited and did not approve based on high truck
 traffic. APCD has essentially ruled out any locations on the north side of 101. NO
- Timbers restaurant (behind restaurant adjacent to block wall), landowner acceptable, APCD ruled location out due to truck traffic and north side of 101. NO
- Timbers grassy area near Timbers sign, landowner acceptable, significant difficulties with City
 permitting issues, but possible. APCD has essentially ruled out any locations on the north side of
 101. <u>Maybe</u>
- 2 City public works property locations on Las Armas Rd. One deemed not acceptable due to high power lines nearby, other location was denied due to planned residential development. NO
- City owned park area across from Ellwood School. Not likely as station will probably not fit current land use???

